

UTAH STATE CAPITOL ARCHITECTURE: EXTERIOR SURVEY REPORT

ELEVATION LOCATION: EAST ELEVATION

Survey Date: 4/25/00

Code: EX-001

Description: Foundation stone

Location: front steps

Grid: B/S6.6

Condition: BR, INT

Broken element, intrusive element

Comments: metal anchors



Code: EX-001

Description: Foundation stone

Location:

Grid: B/S 90; B/N 60

Condition: J

Mortar joint with missing or loose mortar

Comments:



Code: EX-001

Description: Foundation stone

Location:

Grid: C/S 90

Condition: CR

Cracked element

Comments:



Code: EX-001

Description: Foundation stone

Location: south side

Grid: B/S70, S 62

Condition: CR, J

Cracked element and mortar joint damage

Comments: 30" crack and 3" joint



Code: EX-001**Description: Foundation stone****Location:** center**Grid:****Condition:** CR, J

Cracked element and mortar joint damage

Comments: CR threshold, center door 30" B/L ; J2" B/N-6**Code: EX-001****Description: Foundation stone****Location:****Grid:** B/N-19**Condition:** BR, PAT

Broken element, poor quality patching

Comments: broken piece patched back in.**Code: EX-003****Description: Lower belt course****Location:****Grid:** G/S 54**Condition:** J

Mortar joint with missing or loose mortar

Comments: 6"**Code: EX-006****Description: Pilaster shaft****Location:****Grid:** E & D / S 74**Condition:** EX

Exfoliated or spalled surface

Comments:

Code: EX-007

Description: Pilaster capital

Location:

Grid: F/N 102, N 116

Condition: BR

Broken, severely cracked or
chipped

Comments:



Code: EX-008

Description: Wall stone

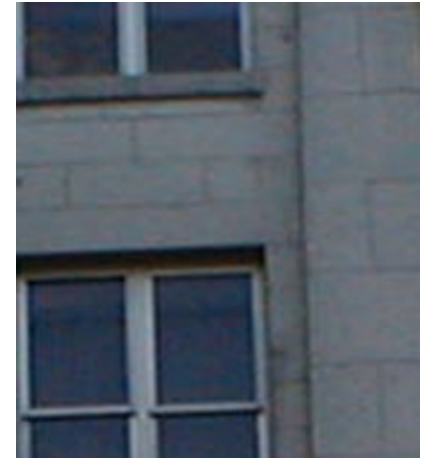
Location:

Grid: E/N 116

Condition: CR

Cracked element

Comments:



Code: EX-009

Description: Entablature lower belt

Location:

Grid: F/S 90

Condition: CR

Cracked element

Comments: soon to be BR



Code: EX-010

Description: Entablature frieze

Location:

Grid: G/74

Condition: C

General Cleaning Needed

Comments: dentil joint dark, wreath dark



Code: EX-012

Description: Entablature cornice

Location:

Grid: G/S 95

Condition: ST

Significant Staining; may
indicate rusted connector

Comments:



Code: EX-012

Description: Entablature cornice

Location: at front steps

Grid: G/S 70-90

Condition: BR, ST

Broken element, significant
staining

Comments:



Code: EX-012

Description: Entablature cornice

Location:

Grid:

Condition: BR, ST

Broken element, significant
staining

Comments:



Code: EX-012

Description: Entablature cornice

Location:

Grid: G/S 90

Condition: J, ST

Mortar joint damage and
significant staining

Comments:



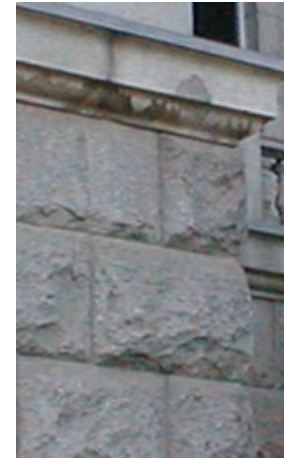
Code: EX-012**Description: Entablature cornice****Location:** center**Grid:** G/H, N/S 46**Condition:** ST, CR

Significant staining and cracking

Comments: ST-3 spots, 2 medallions are whiter (new?) with severe staining behind and beneath.

**Code: EX-017****Description: Balustrade baluster****Location:****Grid:** C/S 38**Condition:** PAT, ST, EX

Poor patching, staining, and exfoliation

Comments:**Code: EX-018****Description: Balustrade railing****Location:****Grid:** H/S 80**Condition:** BR

Broken, severely cracked or chipped

Comments:**Code: EX-018****Description: Balustrade railing****Location:****Grid:** H/S 60**Condition:** J, ST

Mortar joint damage and significant staining

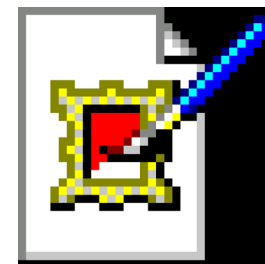
Comments: significant staining

Code: EX-018**Description:** Balustrade railing**Location:** North entrance**Grid:** H/N 95**Condition:** J

Mortar joint with missing or loose mortar

Comments:**Code:** EX-033**Description:** Column base**Location:** stair wall south side of ramp**Grid:** 19.9S-B**Condition:** BR

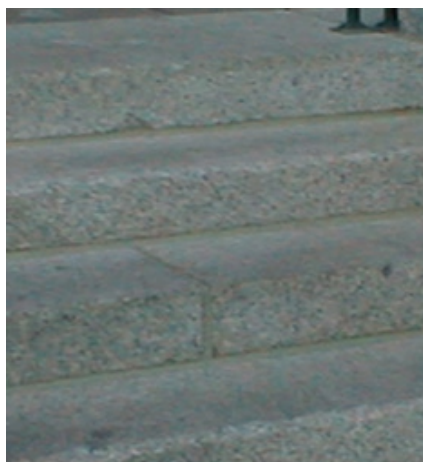
Broken, severely cracked or chipped

Comments:

#26.jpg

Code: EX-074**Description:** Stairs**Location:** stairs**Grid:** B/N-10**Condition:** BR

Broken, severely cracked or chipped

Comments:**Code:** EX-093**Description:** Trim**Location:****Grid:** C/S 46, N 46**Condition:** NO

Non-original, incompatible but essential elements

Comments: grey flashing/ protector

Code: EX-094

Description: Trim

Location:

Grid: D/N 75

Condition: EX, PAT

Exfoliation, poor patching

Comments:



Code: EX-095

Description: Trim

Location:

Grid: F/S 90

Condition: BR

Broken, severely cracked or
chipped

Comments:

